

Website: LegacyLLC.com


General Inquiries: contact@legacyllc.com

Orders: orders@legacyllc.com


Main Office: 415 Concord Avenue Bronx, NY 10455


## **Door Flood Barrier** #5029MA, 5129MA

# **Interlocking Flood Shield for Oversized Openings**

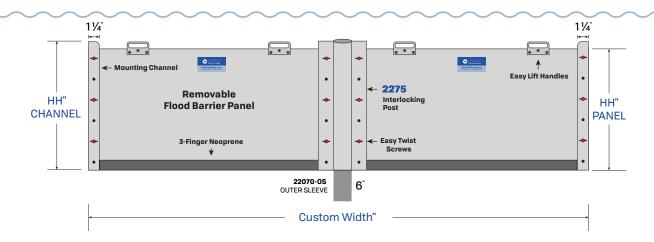


## #5029 MOUNTED TO INSIDE OF FRAME



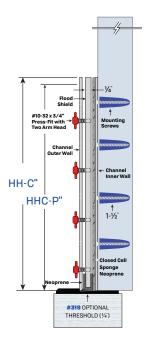



### #5129 🏖 **MOUNTED TO OUTSIDE OF FRAME**

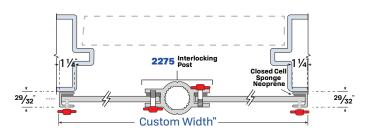

Panel	5052 type Marine-grade Aluminum Alloy
Channels	1-1/4" x 29/32" x 1/8" aluminum extrusion 6062 alloy T5-T6, with 10-32 stainless steel Allen head tightening screws every 8" on center.
Seals	Neoprene lines the bottom of the shield. Sponge Rubber lines the channels. Our seals are composed of high-density rubber extrusions for increased strength with a low hardness that provides superior compression.
Hardware	#10 x1-1/2" FHPH with plastic expansion tube anchors. Snap covers for safety provided for the top of the channels and for the mounting holes.
Installation	Can be installed on hollow metal, aluminum or wood frames, and on concrete, brick or metal surfaces.
Floor Surface	We recommend our #319 Threshold (1/4" x 2" beveled aluminum plate)
PROJECT	
DATE	

Website: DoorFloodBarrier.com

General Inquiries: contact@legacyllc.com

Orders: orders@legacyllc.com

Main Office: 415 Concord Avenue Bronx, NY 10455

Phone: (718) 292-5333 Fax: (888) 383-3330

**COMPANY** 

**NOTES**